

COMMONWEALTH OF KENTUCKY
BEFORE THE PUBLIC SERVICE COMMISSION

In the Matter of:

FOOTHILLS RURAL TELEPHONE)	
COOPERATIVE CORPORATION, INC.)	
)	
_____)	CASE NO. 98-593
)	
ALLEGED FAILURE PURSUANT TO 807)	
KAR 5:041, SECTION 3, TO COMPLY WITH)	
NATIONAL ELECTRIC SAFETY CODE,)	
1990 EDITION, SECTION 42, RULE 420 H;)	
RULE 421 A; RULE 422 A; AND, SECTION)	
43, RULE 431)	

O R D E R

Foothills Rural Telephone Cooperative Corporation, Inc. ("Foothills RTCC") is a Kentucky corporation which engages in the transmission or conveyance over wire, in air or otherwise, of any message by telephone or telegraph for the public for compensation and is a utility subject to the Commission's jurisdiction. KRS 278.010(3)(e) and KRS 278.516(2).

KRS 278.280(2) directs that the Commission is to prescribe rules and regulations for the performance of services by utilities. Pursuant to this statutory directive, the Commission promulgated Administrative Regulation 807 KAR 5:041, Section 3, which requires telephone utilities to maintain their plant and facilities in accordance with the standards of the National Electric Safety Code ("NESC").

Commission Staff submitted to the Commission a Utility Accident Investigation Report dated August 6, 1998, attached hereto, which alleges that:

1. Big Sandy Rural Electric Cooperative Corporation ("Big Sandy") maintained a single-phase distribution line carrying 7,620 V on Patterson Creek at Flat Gap, Johnson County, Kentucky. Big Sandy's line was built over (over-built) a telephone communication line constructed and maintained by Foothills RTCC. Each system co-existed within the same easement space with the Big Sandy line simply being higher than the other.

2. On May 20, 1998, Foothills RTCC was in the process of replacing one of its old communication poles with a new 25 foot pole. The old pole and the hole for the new pole were located between two Big Sandy poles to which was attached the single-phase distribution line.

3. Four (4) employees of United, Inc., Dewey Lemaster, Donald McCoy, Anthony McDowell, and Paul Hale acting on behalf of Foothills RTCC, were working to set the new 25-foot communication pole adjacent to the old pole. Lemaster was the foreman in charge of the work crew and McCoy and McDowell were physically attempting to set the new pole by pushing and maneuvering it into the hole which had been prepared.

4. The crew was using a block and tackle rigging and Lemaster was operating a digger derrick truck's wench line. The block and tackle was attached to the old pole of Foothills RTCC and was attached to two (2) of Big Sandy's distribution poles.

5. In pushing and maneuvering the new pole, McCoy and McDowell caused the top of the pole to contact the energized primary conductor and the neutral conductor of Big Sandy's energized line facilities. The new pole was scarred with a burn mark 56 2/3 inches from the top.

6. McCoy and McDowell each received a shock. McCoy was transported to the local hospital but McDowell did not seek medical attention.

7. NESC, Section 42, Rule 420 H, mandates that employees shall use personal protective equipment and Rule 422 A specifically addresses employees who are setting, moving, or removing poles in or near energized electric supply lines. 422 A mandates that employees "shall wear suitable insulating gloves or use other suitable means" Neither Donald McCoy nor Anthony McDowell were wearing rubber gloves and sleeves, which violates NESC, Section 42, Rule 420 H and Rule 422 A.

8. Dewey Lemaster was the foreman in charge of the work crew when the accident occurred and he was operating the truck wench in an attempt to set the new communication pole. NESC, Section 42, Rule 421 A provides that the person in charge shall see that safety rules and operating precautions are followed by persons under his direction. By failing to direct McCoy and McDowell to wear protective equipment and to use safe procedures as hereinabove set out, Lemaster violated NESC, Section 42, Rule 421 A.

9. NESC, Section 43, Rule 431 provides minimum distances which employees shall observe when they take any conductive object (new pole) near exposed energized facilities (Big Sandy's 7,620 V distribution line). McCoy, McDowell, and Lemaster violated NESC Section 43, Rule 431 because the new pole contacted the distribution line of Big Sandy.

10. Commission Staff measured all clearances of the energized distribution line of Big Sandy and determined that the energized facilities met or exceeded allowable NESC distances. Big Sandy was not in violation.

The Commission, based upon the facts contained in the Utility Accident Investigation Report, finds sufficient evidence to believe that Foothills RTCC has failed to comply with 807 KAR 5:041, Section 3; NESC, Section 42, Rules 420 H, 421 A, and 422 A and Section 43, Rule 431.

The Commission, on its own motion, HEREBY ORDERS that:

1. Foothills RTCC shall submit to the Commission within 20 days of the date of this Order a written response to the allegations contained in the Utility Accident Investigation Report.

2. Foothills RTCC shall appear on the 14th day of January, 1999 at 10:00 a.m., Eastern Standard Time, in Hearing Room 1 of the Commission's offices at 730 Schenkel Lane, Frankfort, Kentucky for the purposes of presenting evidence regarding the alleged violations of Commission Regulation 807 KAR 5:041, Section 3 and NESC, Section 42, Rule 420 H; Rule 421 A; Rule 422 A ; and, Section 43, Rule 431 and of showing cause, if any, why it should not be subject to the penalties prescribed in KRS 278.990(1) for the alleged violations.

3. The Utility Accident Investigation Report dated August 6, 1998 is hereby made a part of the record herein.

 
4. Any request for an informal conference with Commission Staff to consider any matter which would expedite the handling or disposition of this proceeding shall be filed with the Commission no later than 20 days from the date of this Order.

Done at Frankfort, Kentucky, this 24th day of November, 1998.


PUBLIC SERVICE COMMISSION


Chairman


Vice Chairman


Commissioner

ATTEST:

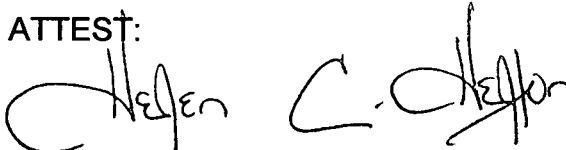
Executive Director

APPENDIX



**AN APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC SERVICE
COMMISSION IN CASE NO. 98-593 DATED NOVEMBER 24, 1998**

UTILITY ACCIDENT INVESTIGATION REPORT

Utility:	Big Sandy RECC ("Big Sandy")	Foothills Telephone Company ("Foothills")
Reported By:	Bruce A. Davis, Jr.	Paul Preston
Dates & Times		
Accident Occurred:	05/20/98 – Between 11:30 a.m. & 11:45 a.m.	
Utility Notified:	05/20/98 – 12:20 p.m.	05/20/98 – 11:45 p.m.
PSC Notified:	05/20/98 – 12:32 p.m.	05/20/98 – 1:50 p.m.
Investigated:	05/21/98	
Written Report Rcvd:	05/20/98	05/21/98
Location of Accident:	The accident occurred on Patterson Creek at Flat Gap, Kentucky in Johnson County.	
Description of Accident:	<p>Mr. Dewey Lemaster, Donald McCoy, Anthony McDowell, and Paul Hale, all United, Inc. employees were in the process of setting a new pole in line when Mr. McCoy was injured. The crew was using a block and tackle rigging attached to Foothills' old pole to pull in the new pole. Foothills' cable was attached to the old pole and was also attached to two of Big Sandy's poles on either side of it. Mr. Lemaster, Foreman, was operating the digger derrick truck's winch line, which was attached to the block and tackle rigging at the time of the accident. Mr. Lemaster said he believed that in the process of setting the new pole, Big Sandy's poles were pulled closer together, at which time the new pole contacted Big Sandy's energized line. Mr. McCoy and Mr. McDowell were trying to push the new pole into the hole when it contacted the energized line facilities. Mr. McCoy and Mr. McDowell both received a shock. Mr. Hale was standing near by but received no shock. Mr. McCoy was transported to the hospital. Mr. McDowell did not seek medical attention. Mr. Lemaster was the foreman in charge at the time of the accident. Mr. McCoy and Mr. McDowell were not wearing protective equipment at the time of the accident. United, Inc. was a subcontractor for Foothills at the time of the accident.</p>	

Victims:						
	Name:	Donald D. McCoy	Fatal:	No	Age:	29
	Addr./Empl.:	Rt. 4, Box 12232, Louisa, Kentucky/United, Inc., 307 Main St., P O Box 310, French Lick, Indiana				
	Injuries:	Shock				
Witnesses:	Name	Address/Employment				
	Howard Dewey Lemaster	Rt. 2, Box 650, Louisa, Kentucky United, Inc. employee				
	Anthony McDowell	HC 81, Box 330, Blain, Kentucky United, Inc. employee				
	Paul Hale	Unknown/United, Inc. employee				
Sources of Information:	Name	Address/Employment				
	Arlie O. Daniel	Big Sandy RECC employee				
	Dan Hitchcock	Big Sandy RECC employee				
	Paul Preston (General Manager)	Foothills Rural Telephone employee				
	Lonnie Kelly	Foothills Rural Telephone employee				
	Jim Patton	Foothills Rural Telephone employee				
	Donald L. Renner (Owner)	United, Inc. employee				
	Dewey Lemaster (Foreman)	United, Inc. employee				
	Jeff McDowell	United, Inc. employee				
	Anthony McDowell	United, Inc. employee				
	Paul Hale	United, Inc. employee				
	Probable Violations KAR 5:061, Section 3:	National Electric Safety Code (NESC) 1990 Edition, Section 42 and 43, Rules for Employees. Rule 420H and 422A. Mr. Dewey Lemaster, Mr. Donald McCoy, and Mr. Anthony McDowell were setting a new pole near energized electric supply lines and were not wearing personal protective equipment (Rubber Gloves and Sleeves). Rule 421A. Mr. Dewey Lemaster was the foreman in charge when the accident occurred.				
Line Clearances At Point of Accident:	Measured	Minimum Allowed by NESC	Applicable NESC Edition¹ 1990	Volt.	Constr. Date	
Phase Conductor to Ground Elevation:	25' - 2"	14' - 6"	Table 232-1	7620V	1994	

  ¹ Current edition adopted by the Commission. If clearances are not in compliance with the current edition, then the edition in effect when the facilities were last constructed or modified would apply.

Neutral Conductor to Ground Elevation:	21' - 6"	9' - 6"	Table 232-1	N/A	1994
Comm. Conductor to Ground Elevation:	14' - 6"	9' - 5"	Table 232-1	N/A	1966
Phase Conductor to Foothills Pole:	9' - 3"	8' - 0"	Table 241-1	7620V	1994
Neutral Conductor to Foothills Pole:	5' - 7"	3' - 0"	Table 234-1	N/A	1994
Phase Conductor to Foothills Cable:	10' - 6"	6' - 0"	Table 233-1	7620V	1994
Neutral Conductor to Foothills Cable:	7' - 0"	2' - 0"	Table 233-1	N/A	1994
Date of Measurement:	05/21/98				
Approximate Temp.:	83°F				
Measurements Made By:	John W. Land and Vern Miracle, PSC Engineering Staff				
Investigated By:	John W. Land and Vern Miracle, PSC Engineering Staff				
Signed:					

- Attachments
- A. Big Sandy RECC's Accident Report
 - B. Foothills Rural Telephone's Accident Report
 - C. Photographs of Accident Site

Attachment A

Big Sandy RECC's Accident Report



Big Sandy Rural Electric Cooperative Corporation

504 11th Street
Paintsville, Kentucky 41240-1422
(606) 789-4095 • Fax (606) 789-5454

Branch Office:

Box 8, Glyn View Plaza
Prestonsburg, KY 41653
(606) 886-2987

RECEIVED

MAY 26 1998

DIVISION OF UTILITY
ENGINEERING & SERVICES

5/22/98

Mr John Land
Kentucky Public Service Commission
P.O. Box 615
Frankfort, KY 40602

Dear Mr. Land:

Around 11:30 a.m. on Wednesday, May 20 1998, a contractor for Foothills Rural Telephone was setting a 25' telephone pole off an old telephone pole in mid-span between Big Sandy RECC's poles. The pole came in contact with the phase and neutral. From top of pole down to the burn mark measured 56 3/4". No other burn marks were found. Vines in a tree next to where they were setting the pole may have got tangled around the pole as it was being set. This happened on Patterson Creek at Flat Gap, Kentucky in Johnson County.

Measurements from: Phase to ground.....25' Neutral to ground.....21' 5"
Contractors name: United.....Name of person shocked: Donald McCoy

We were notified by Foothills Rural Telephone about the electrical contact at 12:20 p.m. Arlie Daniel and myself went to the accident site to investigate. Bruce Davis Jr., General Manager for Big Sandy RECC called Foothills Telephone back around 12:25 p.m. and then reported the accident to the Public Service Commission about 12:35 p.m. I talked with you at 2:20 p.m. and gave an update on the situation.

Diagram of accident site and pictures are enclosed. Also I have enclosed the staking sheet for that particular area and a copy of our annual meter reading report for that area. As you can see by the date on the report, the last time was 9/25/97.

If you need any further information, please contact Arlie Daniel or myself.

Sincerely,

Dan Hitchcock
Member Service Department

Enclosures

7. Friday
9-25-97

15410 1-57-7
16C71

Checked

SEP 17, 1997

BIG SANDY RECC
ANNUAL METER READING REPORT


UBEEMTRS-01
10/2/97

ACCOUNT NO	METER NO	CONSUMER NAME	NO OF LIGHTS	
001-66-052-02	284274	JIMMY R LEMASTER 9-25	0	2307
001-66-053-04	564276	JOE H ROSEBERRY	0	2014
001-66-054-15	900051273	ROBERT CURTIS 9-25	1✓	5635
001-66-055-04	371288	GEORGE THACKER 9-25	1	350
001-66-056-02	900320284	DAN BARKER 9-23	0	0915
001-66-057-04	100052	TERESA ESTEP 9-25	0	4004
* 001-66-058-02	-432286	PAUL BRIAN CANTRELL	0	✓
001-66-059-04	900447284	KRISTIE DAVIS 9-25	0	1694
001-66-060-03	184294	SANDRA ESTEP 9-25-97	1	3931
001-66-061-01	122294	MICHAEL ESTEP 9-25	0	54461
001-66-062-03	900274286	JAMES A SALYERS 9-23	0	6965
001-66-063-01	900114286	GEORGE THACKER 9-25	1✓	086
001-66-064-03	506275	KERRY L ROBERTS 9-24	0	0170
001-66-065-01	900123281	RICK CALDWELL 9-24	1✓	0002
001-66-067-01	190297	HOMER CANTRELL 9-24	0	0003
001-67-001-06	900043584	ROBERT STURGILL 9-25	✓ 4.5	1004
001-67-002-17	276272	LOUISE LEMASTER 9-22	1✓	0264
001-67-003-15	900145277	MALTA SALYER	meter inside	decumul. no use
001-67-006-04	384295	CLINT SALYER JR 9-22	0	2961
001-67-007-28	367295	JOHN O BOLTON 9-24	0	1214
001-67-008-04	421287	CHARLES BOWLES 9-25	1✓ 4.5	2973
001-67-009-06	46287	BETHEL CHURCH 9-25	1✓	12251
001-67-010-14	900191284	DENVER SALYER 9-25	1✓	29997
001-67-011-38	900231288	WILLARD C RAMEY 9-25	1✓	146
001-67-012-30	397295	TOMMY STANIFORD 9-25	0	3192

7

Phase

Neutral

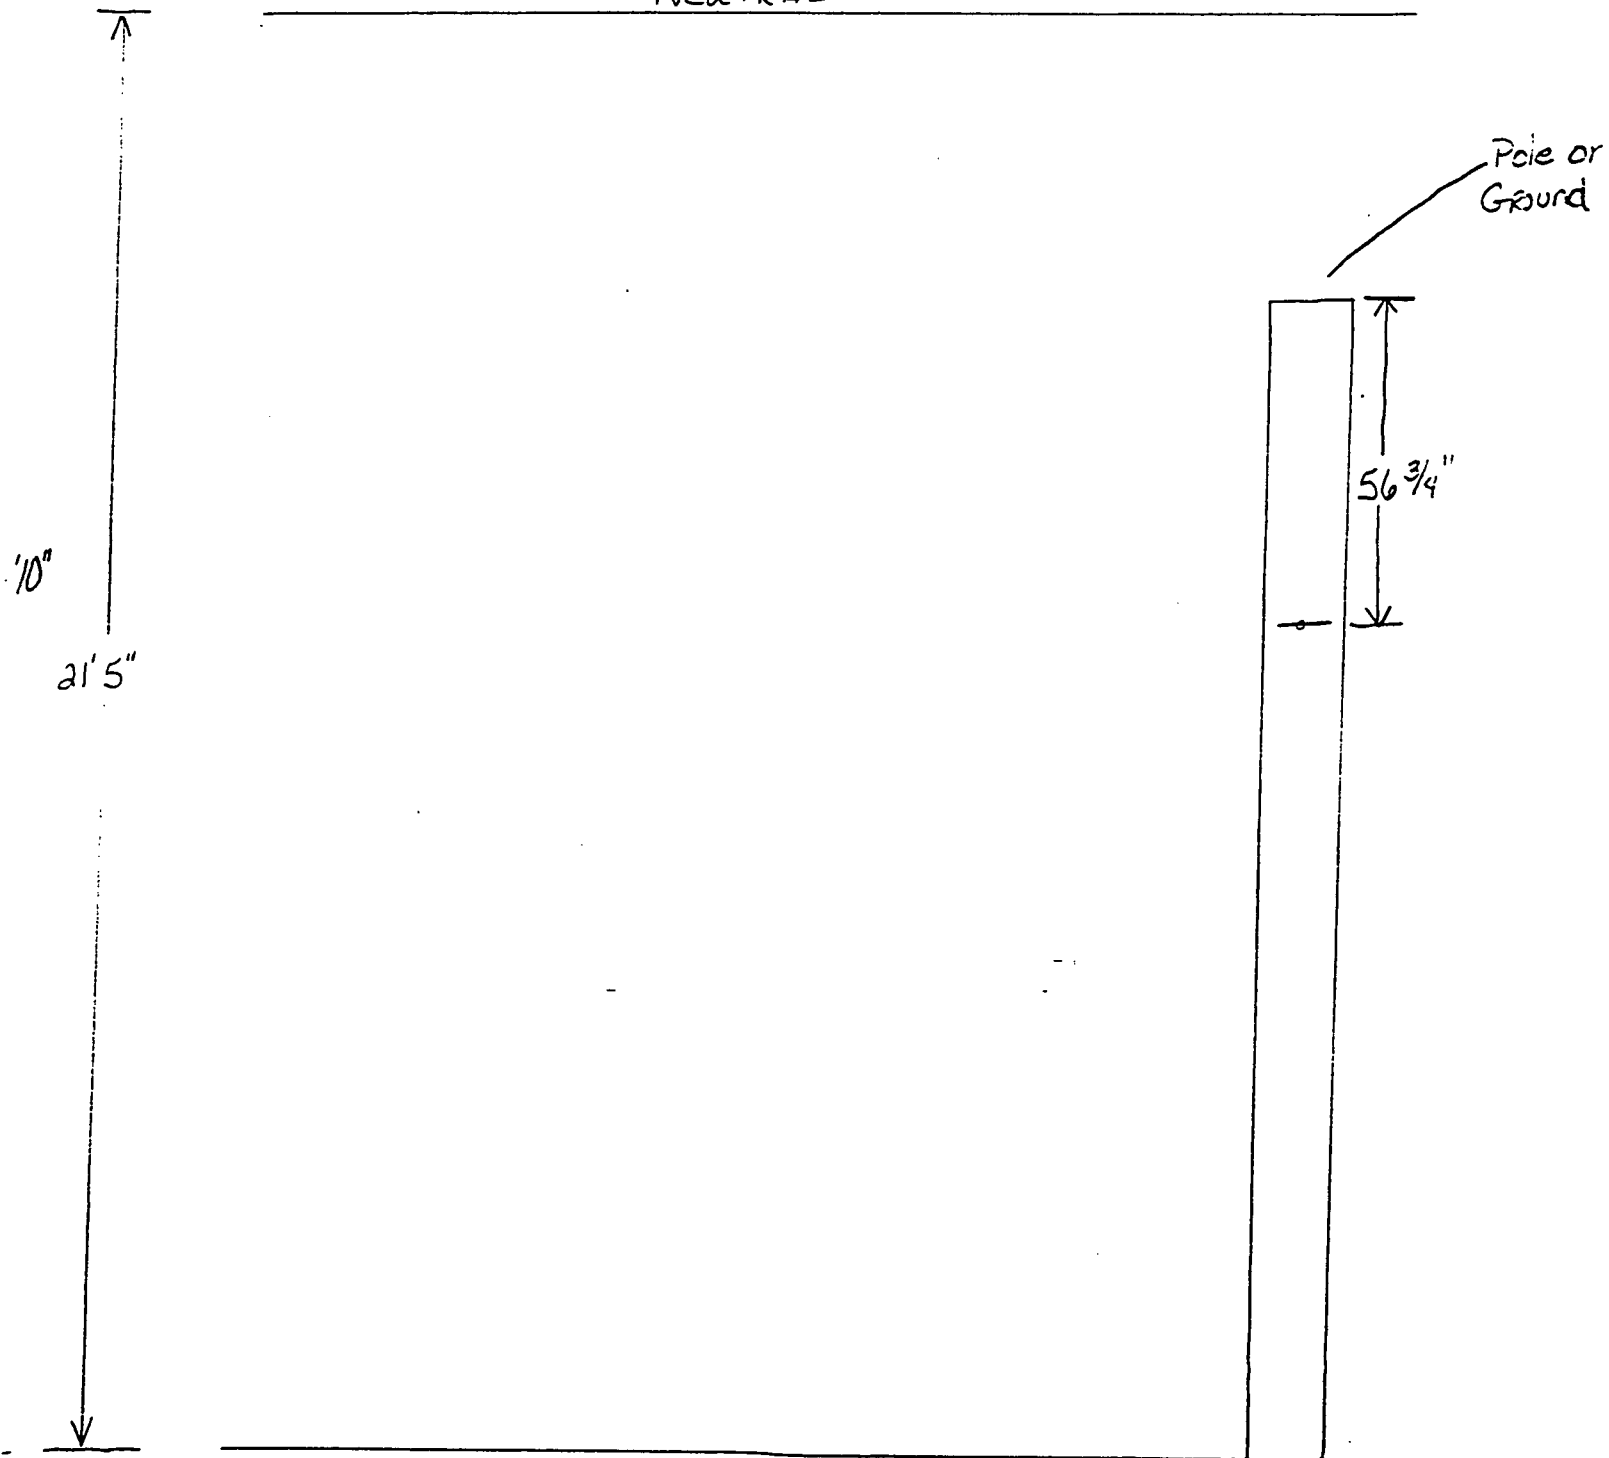

BIG SANDY RURAL ELECTRIC
COOPERATIVE CORPORATION
PAINTSVILLE, KENTUCKY
41240

Staking Sheet

SYSTEM DESIGNATION: KY. 88 FLOYD

CONST. WORK ORDER NO. 9922

RET. WORK ORDER NO.

Work Plan Reference 183


SHEET NUMBER OF

P O L E	PRI. BACK SPAN	WIRE SIZE	POLES H & C	PRI. UNIT	R/W	A N C L E	TRANS. G	M 2	GUYS E	L E A D	ANCHOR T	SECONDARY				SERVICE				REMARKS
												U. B.	WIRE	SEC.	WIRE	SPAN	K	WIRE	METER	
1	37	4	70	5	10	10	10	10	10	10	10	N	N	N	N	N	N	N	N	
2			209																	

N = NEW UNITS

I = REMOVAL UNITS


EXISTING UNITS TO REMAIN = 0

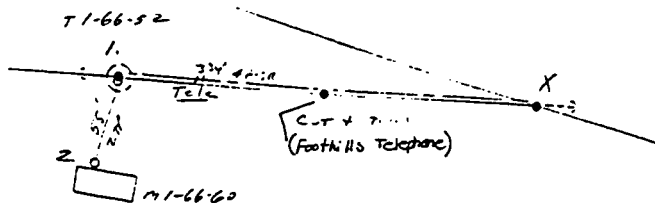

NAME Edwin E. E. E.
ADDRESS 1126 1/2 St. E.
LOCATION 1126 1/2 St. E.
STAKED BY DATE
PRINT BY DATE
MATERIAL CHECKED BY DATE
DATE ISSUED 7-18-94
FOREMAN DATE COM.
INSPECTED BY DATE

REMARKS:

Tailgate
Discussion Held
NEW SERVICE ☒
RET. SERVICE ☒
REC. ONLY ☒
POLE: ADD. ☒ SERVICE ☒ REMOVE ☒
CHANGE ☒
YARD LIGHT ☒
YARD LIGHT RET. ☒
POLES NEEDED 42-10
POLES NEEDED 22-7
TRANS. 5-10

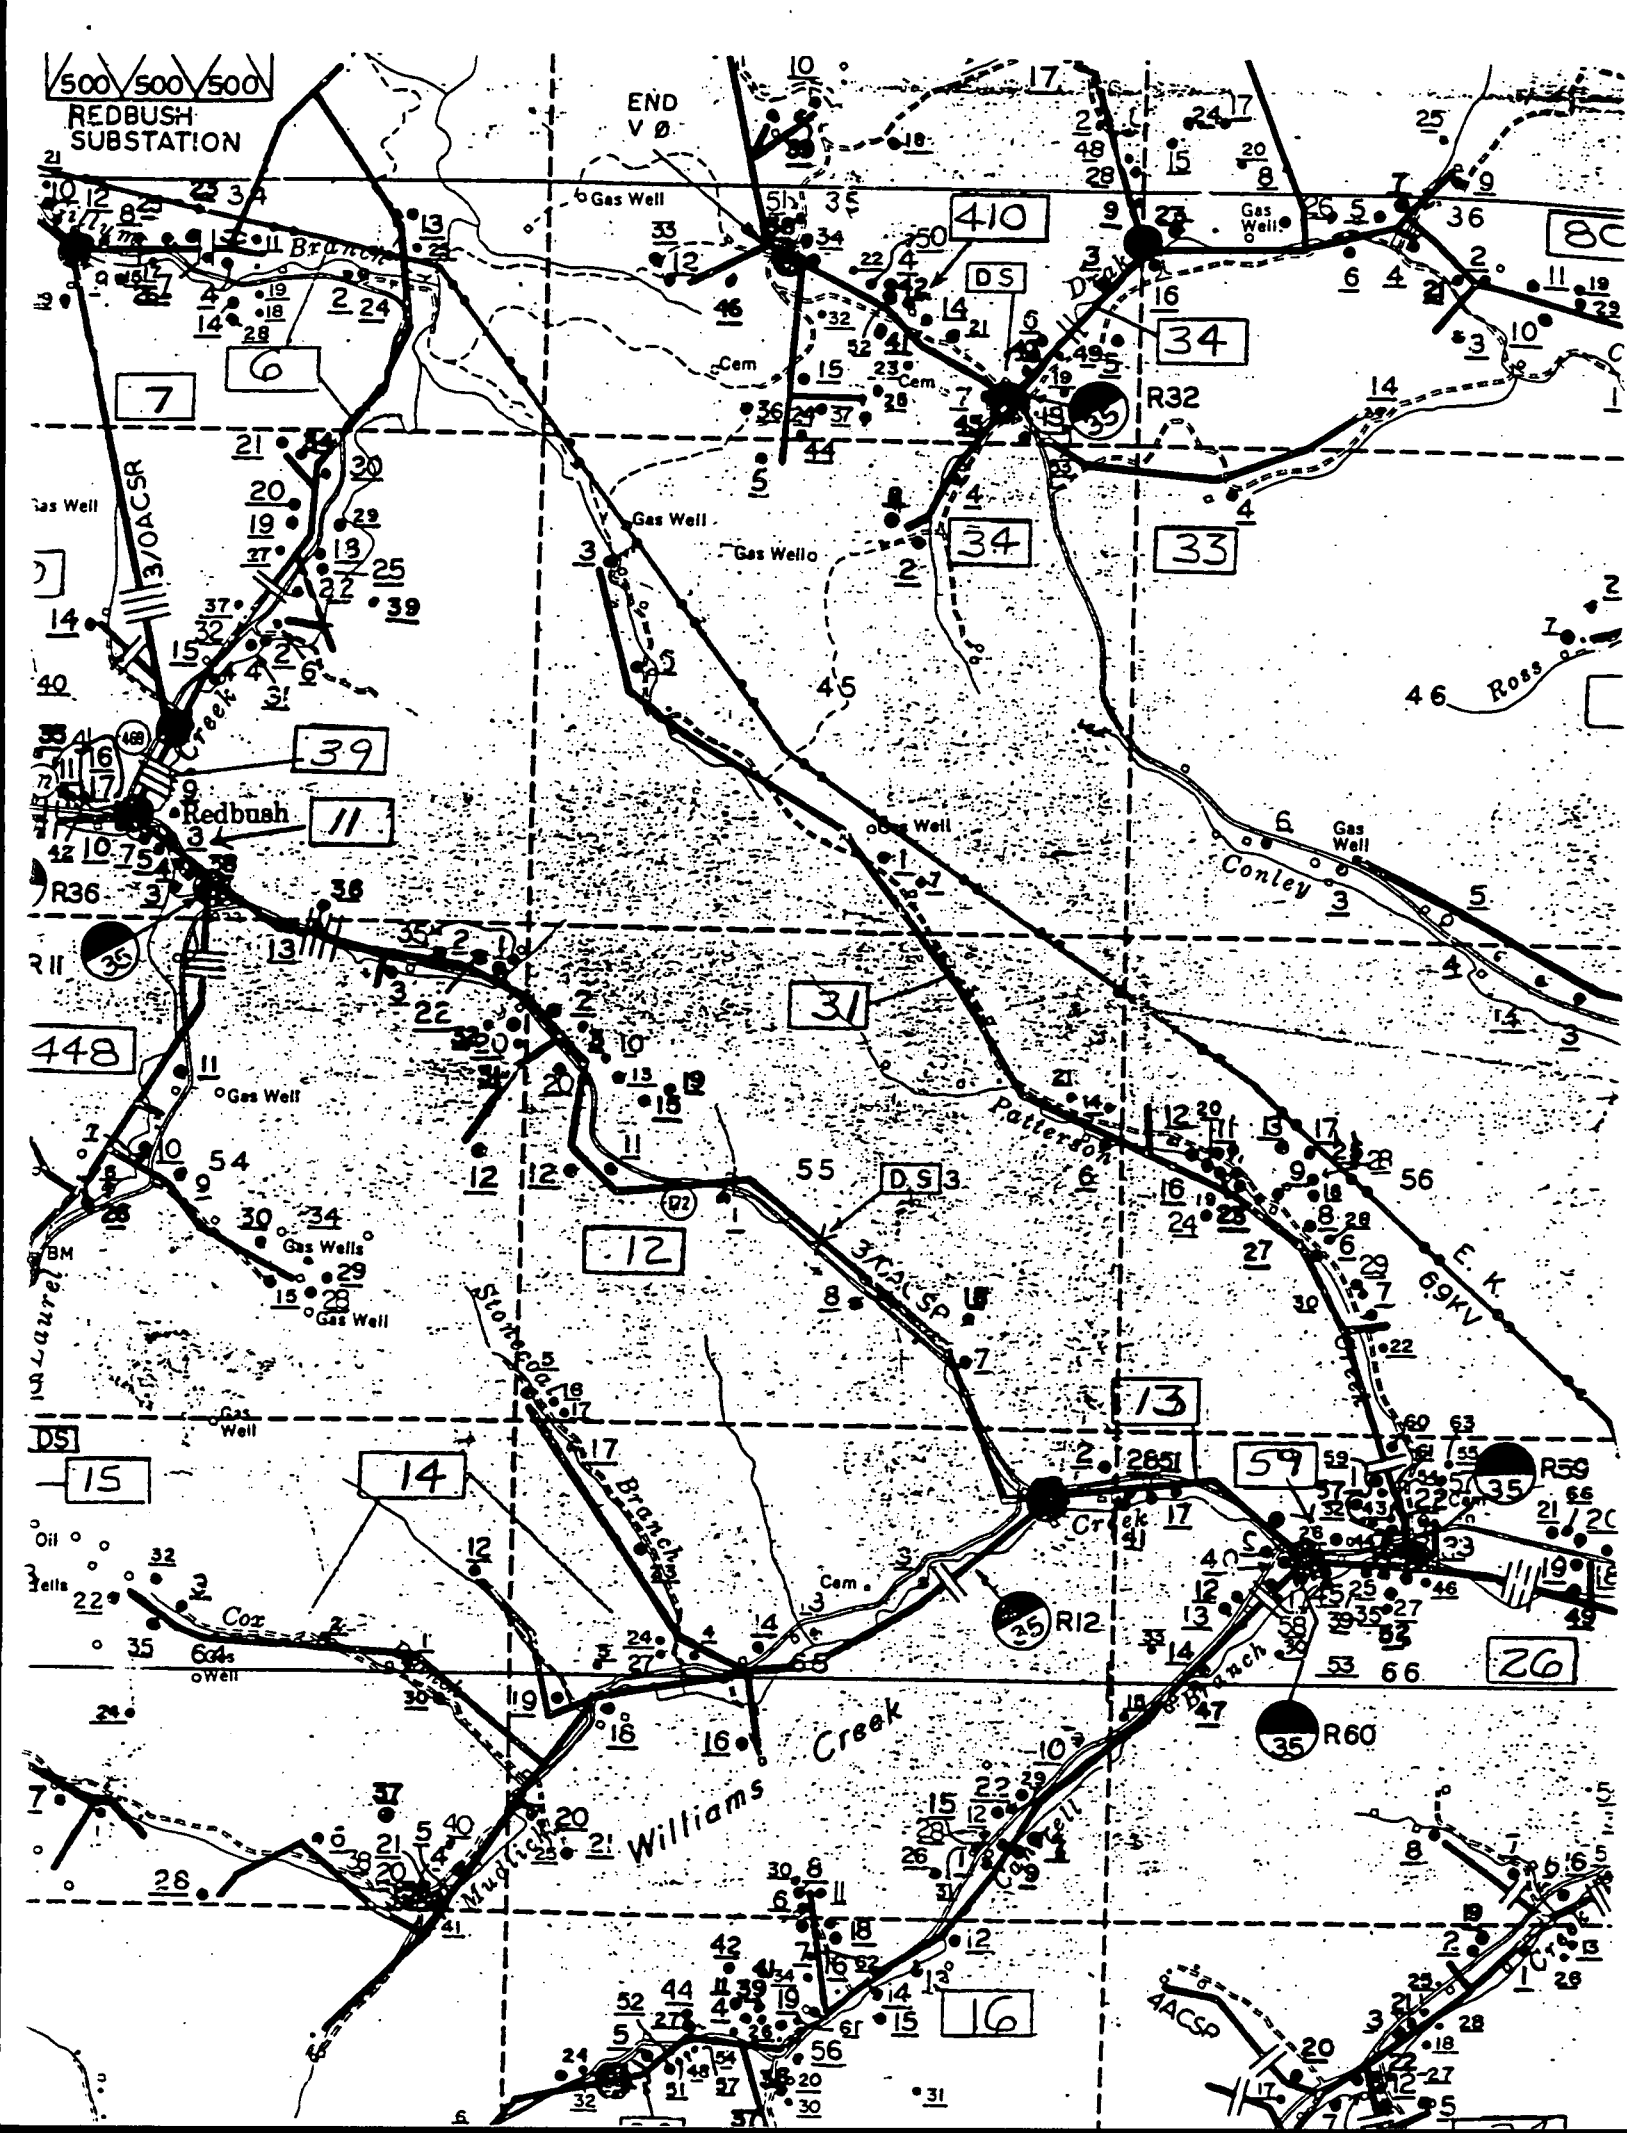

5/21/98

5/20/98


Mr John Land
Kentucky Public Service Commission
P.O. Box 615
Frankfort, KY 40602

Dear Mr. Land:

A contractor for Foothills Rural Telephone was setting a 25' telephone pole off an old telephone pole in mid-span between Big Sandy RECC's poles. The pole came in contact with the phase and neutral. From top of pole down to the burn mark measured 56 3/4". No other burn marks were found. Vines in a tree next to where they were setting the pole may have got tangled around the pole as it was being set. This happened on Patterson Creek at Flat Gap, Kentucky in Johnson County.

Diagram of accident site and pictures are enclosed. If you need any further information, please call me.

Sincerely,

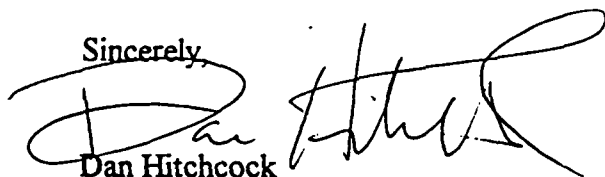A handwritten signature in black ink, appearing to read "Dan Hitchcock", written over the word "Sincerely,".

Dan Hitchcock
Member Service Department

Enclosures

Attachment B

Foothills Rural Telephone's Accident Report



FOOTHILLS RURAL TELEPHONE
COOPERATIVE CORPORATION, INC.

P.O. Box 240
Staffordsville, Kentucky 41256
Telephone Number : 606-297-3501
FAX Number : 606-297-2000

Date: 5/22/98

Following is/are 17 page(s) including this cover.

URGENT

NORMAL _____

TO: COMPANY

CONTACT

ADDRESS

CITY/ST

FAX NO.

P.S.C.
John Land
502-564-1582

FROM: COMPANY

CONTACT

Paul E. Preston

SPECIAL INSTRUCTIONS

STAFFORDSVILLE, KENTUCKY 41256 📞 606-297-3501



FOOTHILLS RURAL TELEPHONE COOPERATIVE CORPORATION, INC.

May 22, 1998

Mr. John Land
Engineering Branch
Public Service Commission
730 Schenkel Lane
P.O. Box 615
Frankfort, KY 40602

Dear Mr. Land:

Attach you will find Foothills' report of accident that you and Vern Miracle investigated on May 21, 1998.

The pole being changed out was placed into service about 1966. Central Associated Engineers did plant inspection on this line in May 1997 as dated on staking sheets.

If I or Lonnie Kelly can be of further help, please call.

Sincerely,

FOOTHILLS RURAL TELEPHONE
COOPERATIVE CORPORATION, INC.

A handwritten signature in cursive script, appearing to read "Paul E. Preston".

Paul E. Preston
General Manager

PEP/syw

Enclosures

cc: Don Renner
United, Inc.

DATE OF Accident = 5/20/1998 Exchange = Flat Gap

TIME ... Approx. = 11:30 to 11:45 Route. A20-P5

TIME Foothills advised by Dewey Lemaster on TWO-WAY Radio approx. 11:45

TIME Foothills (Chadwick Gable) called 911 = 11:46

TIME LK Arrived on scene = 12:10

TIME ... I Radioed to notify Big Sandy Rec 12:15

Ambulance transported .. Donald McCoy to
Paul B. Hall Regional Medical Center
Paintsville, Ky

Anthony McDowell stayed on job site
Individuals that were shocked (1) Donald McCoy (2) Anthony McDowell

United employees that were at scene of accident

Dewey Lemaster

Anthony McDowell

Paul Hale

Donald McCoy.

Foothills employees arrived after accident

Louise Kelly

Jim Patton

Big Sandy Rec Employees

1. SERVICE MAN ?
2. Arlio Daniels
3. DAN Hitchcock

Someone with Big Sandy Rec about PSC
Paul Preston called Wayne Brees, PSC

At site on 5/21/98 10:00 A.M.

John Land PSC

Vern Miracle PSC

Archie Daniels Bq Sandy Recc

Dan H. Holbrook Bq Sandy Recc

Paul Preston Foothills

Louise Kelly Foothills

Jim Patton Foothills

Don Renner United

Dewey Lemaster United

Jeff McDowell United

Anthony McDowell United

Paul Hale United

An Accident occurred on Wednesday
May 20th 1998 in Flat Gap Exchange
on Paterson Creek (A20-PS).

Dewey Reported by Two-Way Company
Radio to Charlana between 11:30 and 11:45 A.M.

Charlana calls 911 and Reported an
accident occurred.

When I arrived on the scene emergency
personnel were already on site.

They ^{were} preparing Donald McCoy for ambulance
transport to Paul B. Hall Regional Medical
Center. He was sitting up on back side.

Dewey said they were pulling poles up
via ropes and pulley with winch on Dodge
Truck.

He said he saw them fall but he thought
they got tangled up in vines on ground he
didn't know they were shocked.


Paul said he look over at them as they
were moving pole up in air with the But of
the pole near the hole that was dug then
he looked around again and Anthony &
Donald were laying on ground several feet
back from the base of pole.


He said Donald was jerking and turning
white looking. They said Donald's eyes was turned
white white up and jerking Anthony was

hoping that Donald wouldn't swallow his tongue.
They said Donald was unconscious for a few
minutes. While this was happening Anthony
put his finger in Donald's palm and
ask him if he could hear him to squeeze
his finger. Donald responded with a
squeeze to his fingers.

A20-P5


Flat Gap

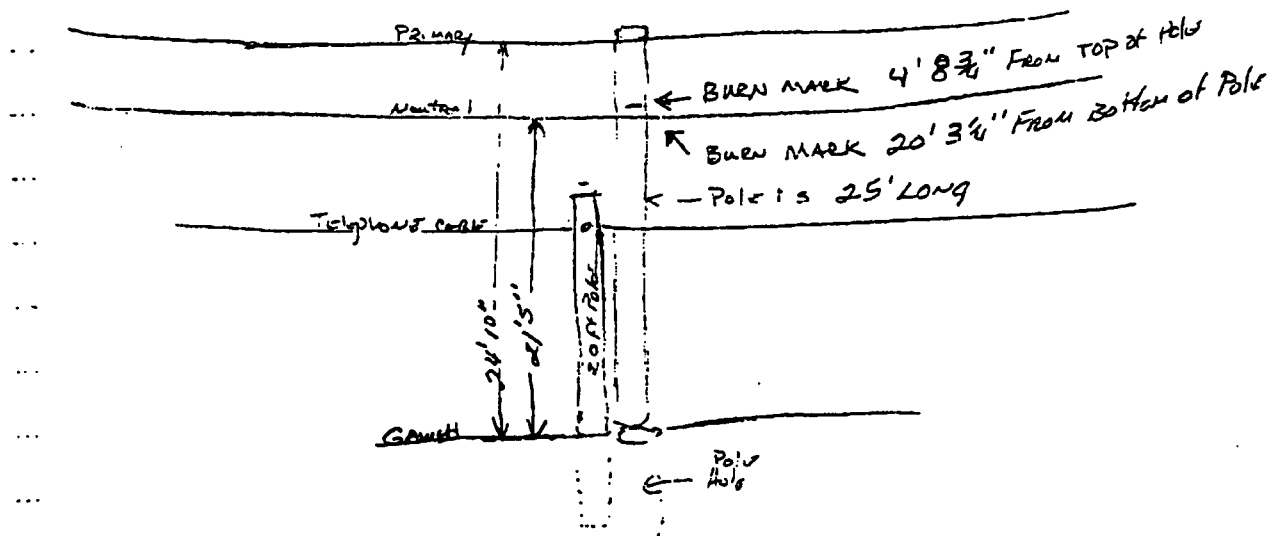

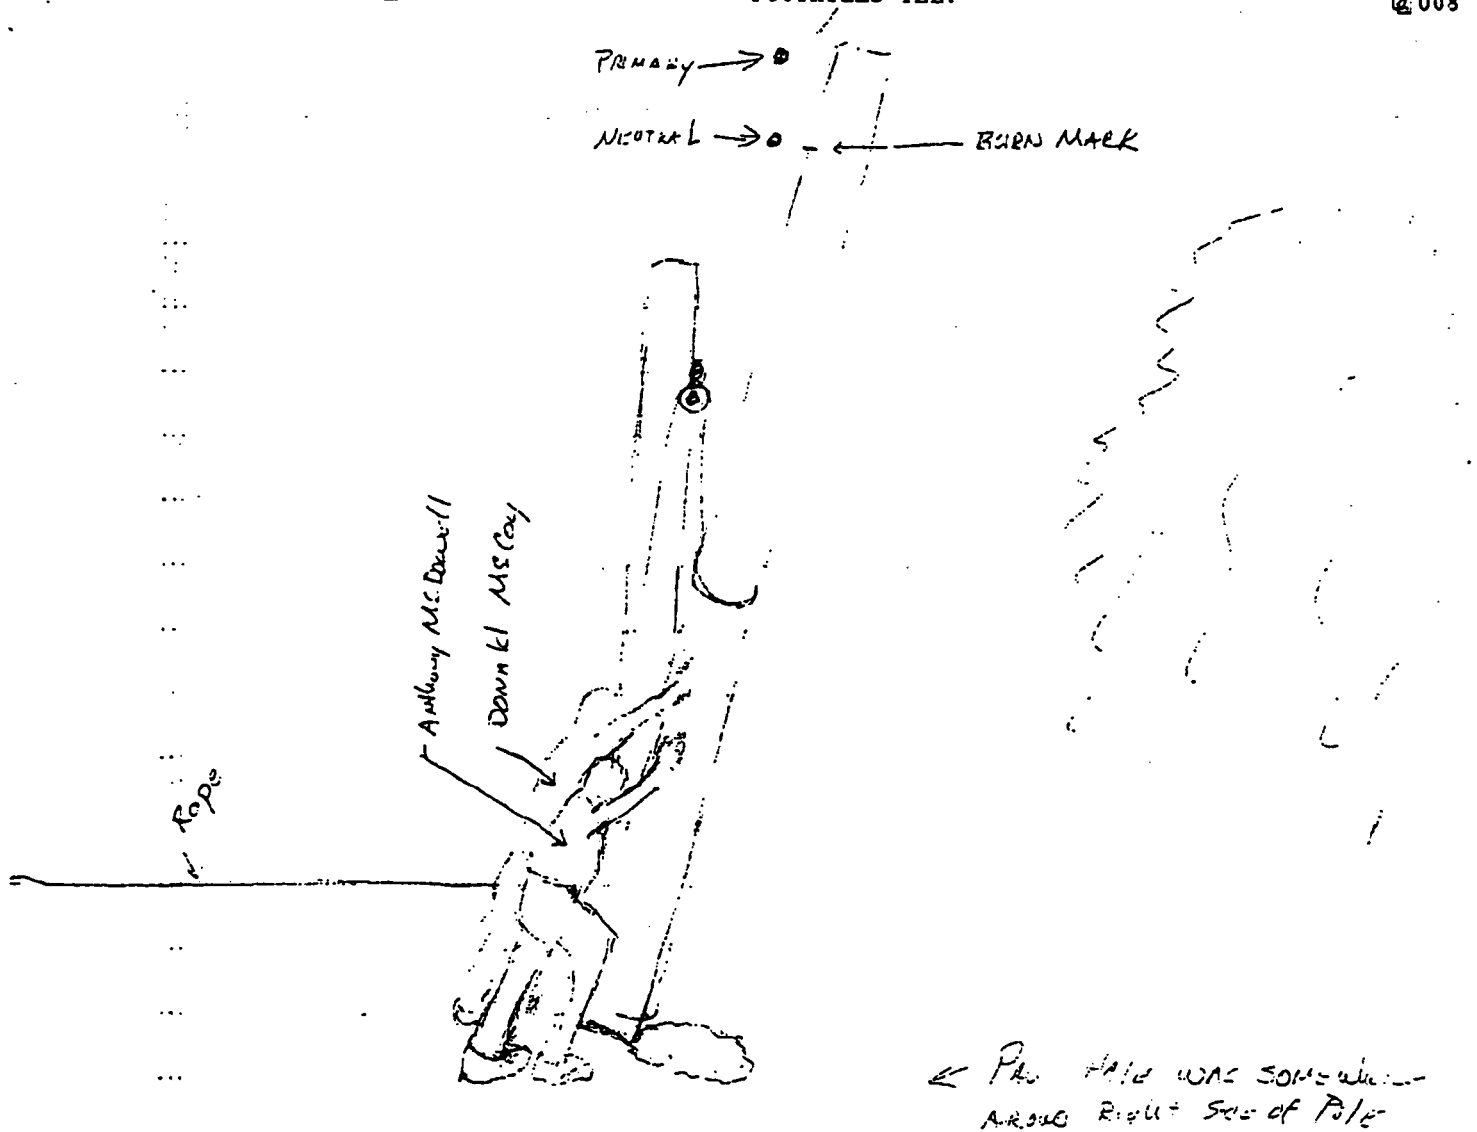

1. Dewey Lemston was operating Truck
2. Donald McCoy, Anthony McDevall & Paul Hale were - Around pole.

Big Sandy Rec Power Line

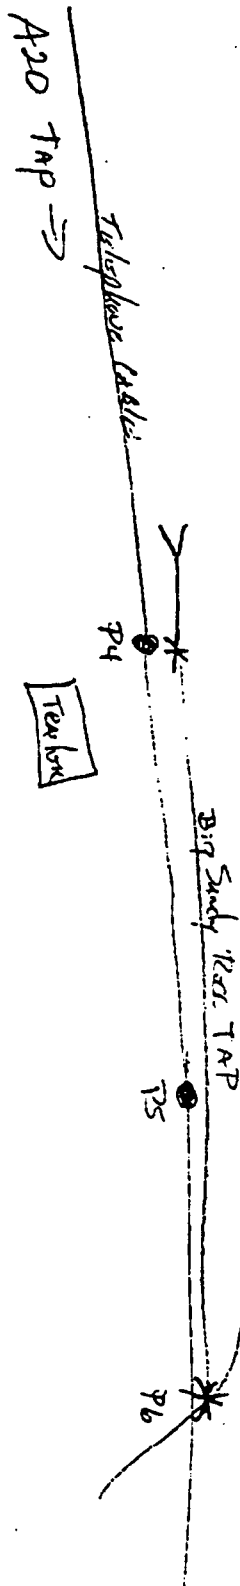

FootHills was over Built by Big Sandy Rec from
P6 to P4 of A20 Tap to receive Power
to a Transformer at P4.

CONSOLIDATED DESIGN CONSULTANTS, INC.


LESLINGTON, KENTUCKY

STATED BY: J. M. L. (LJF)
DATE: 4-79 (6-79)
R/W SECURED BY:
DATE:

CONSTR. REL.
ASSIGN.
COMPL.
AS BUILT

REVISIONS
DATE BY DESCRIPTION

COMPANY: FOOTHILLS
ECHANSE PLANT GAP
LINE A22
SHEET 2 OF 9

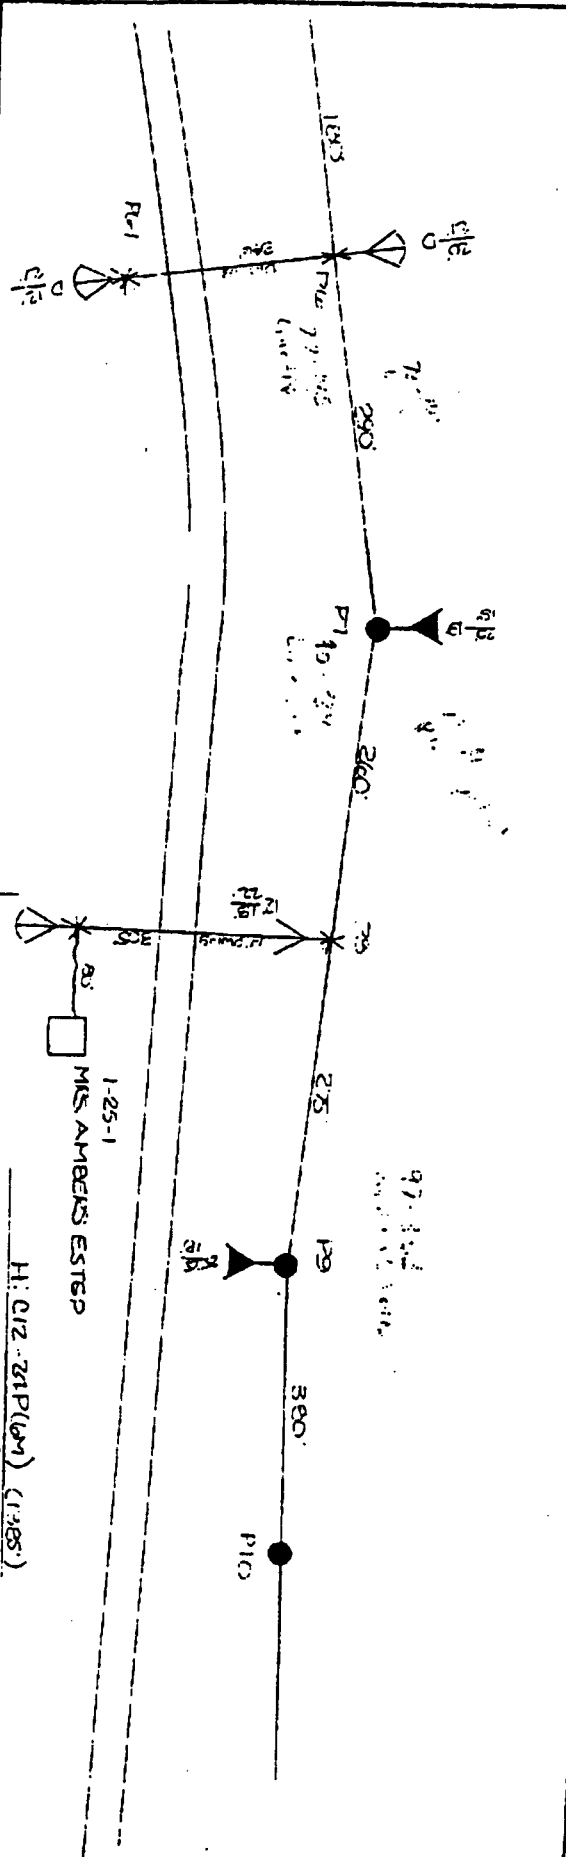

POL. OR P.D. NO.	POL. NO.	YEAR PLACED	R/W	R/S	EST. FE	ARC. FT	TERM. LD COIL. FE	WIRE. IN	ENCL. NA	SPURCE Y MC	PED. LD COIL. BS	TERM. TRENCH BSTD	WIRE. IN	NOTES
1	1				(1-2)	(1-3)	9-6	(1-2)	R1					
2	2				(1-2)	(1-3)	9-6	(1-2)	R1					
3	3				(1-2)	(1-3)	9-6	(1-2)	R1					
4	4				(1-2)	(1-3)	9-6	(1-2)	R1					
5	5				(1-2)	(1-3)	9-6	(1-2)	R1					
6	6				(1-2)	(1-3)	9-6	(1-2)	R1					
7	7				(1-2)	(1-3)	9-6	(1-2)	R1					
8	8				(1-2)	(1-3)	9-6	(1-2)	R1					
9	9				(1-2)	(1-3)	9-6	(1-2)	R1					
10	10				(1-2)	(1-3)	9-6	(1-2)	R1					
11	11				(1-2)	(1-3)	9-6	(1-2)	R1					
12	12				(1-2)	(1-3)	9-6	(1-2)	R1					
13	13				(1-2)	(1-3)	9-6	(1-2)	R1					
14	14				(1-2)	(1-3)	9-6	(1-2)	R1					
15	15				(1-2)	(1-3)	9-6	(1-2)	R1					
16	16				(1-2)	(1-3)	9-6	(1-2)	R1					
17	17				(1-2)	(1-3)	9-6	(1-2)	R1					
18	18				(1-2)	(1-3)	9-6	(1-2)	R1					
19	19				(1-2)	(1-3)	9-6	(1-2)	R1					
20	20				(1-2)	(1-3)	9-6	(1-2)	R1					
21	21				(1-2)	(1-3)	9-6	(1-2)	R1					
22	22				(1-2)	(1-3)	9-6	(1-2)	R1					
23	23				(1-2)	(1-3)	9-6	(1-2)	R1					
24	24				(1-2)	(1-3)	9-6	(1-2)	R1					
25	25				(1-2)	(1-3)	9-6	(1-2)	R1					
26	26				(1-2)	(1-3)	9-6	(1-2)	R1					
27	27				(1-2)	(1-3)	9-6	(1-2)	R1					
28	28				(1-2)	(1-3)	9-6	(1-2)	R1					
29	29				(1-2)	(1-3)	9-6	(1-2)	R1					
30	30				(1-2)	(1-3)	9-6	(1-2)	R1					
31	31				(1-2)	(1-3)	9-6	(1-2)	R1					
32	32				(1-2)	(1-3)	9-6	(1-2)	R1					
33	33				(1-2)	(1-3)	9-6	(1-2)	R1					
34	34				(1-2)	(1-3)	9-6	(1-2)	R1					
35	35				(1-2)	(1-3)	9-6	(1-2)	R1					
36	36				(1-2)	(1-3)	9-6	(1-2)	R1					
37	37				(1-2)	(1-3)	9-6	(1-2)	R1					
38	38				(1-2)	(1-3)	9-6	(1-2)	R1					
39	39				(1-2)	(1-3)	9-6	(1-2)	R1					
40	40				(1-2)	(1-3)	9-6	(1-2)	R1					
41	41				(1-2)	(1-3)	9-6	(1-2)	R1					
42	42				(1-2)	(1-3)	9-6	(1-2)	R1					
43	43				(1-2)	(1-3)	9-6	(1-2)	R1					
44	44				(1-2)	(1-3)	9-6	(1-2)	R1					
45	45				(1-2)	(1-3)	9-6	(1-2)	R1					
46	46				(1-2)	(1-3)	9-6	(1-2)	R1					
47	47				(1-2)	(1-3)	9-6	(1-2)	R1					
48	48				(1-2)	(1-3)	9-6	(1-2)	R1					
49	49				(1-2)	(1-3)	9-6	(1-2)	R1					
50	50				(1-2)	(1-3)	9-6	(1-2)	R1					
51	51				(1-2)	(1-3)	9-6	(1-2)	R1					
52	52				(1-2)	(1-3)	9-6	(1-2)	R1					
53	53				(1-2)	(1-3)	9-6	(1-2)	R1					
54	54				(1-2)	(1-3)	9-6	(1-2)	R1					
55	55				(1-2)	(1-3)	9-6	(1-2)	R1					
56	56				(1-2)	(1-3)	9-6	(1-2)	R1					
57	57				(1-2)	(1-3)	9-6	(1-2)	R1					
58	58				(1-2)	(1-3)	9-6	(1-2)	R1					
59	59				(1-2)	(1-3)	9-6	(1-2)	R1					
60	60				(1-2)	(1-3)	9-6	(1-2)	R1					
61	61				(1-2)	(1-3)	9-6	(1-2)	R1					
62	62				(1-2)	(1-3)	9-6	(1-2)	R1					
63	63				(1-2)	(1-3)	9-6	(1-2)	R1					
64	64				(1-2)	(1-3)	9-6	(1-2)	R1					
65	65				(1-2)	(1-3)	9-6	(1-2)	R1					
66	66				(1-2)	(1-3)	9-6	(1-2)	R1					
67	67				(1-2)	(1-3)	9-6	(1-2)	R1					
68	68				(1-2)	(1-3)	9-6	(1-2)	R1					
69	69				(1-2)	(1-3)	9-6	(1-2)	R1					
70	70				(1-2)	(1-3)	9-6	(1-2)	R1					
71	71				(1-2)	(1-3)	9-6	(1-2)	R1					
72	72				(1-2)	(1-3)	9-6	(1-2)	R1					
73	73				(1-2)	(1-3)	9-6	(1-2)	R1					
74	74				(1-2)	(1-3)	9-6	(1-2)	R1					
75	75				(1-2)	(1-3)	9-6	(1-2)	R1					
76	76				(1-2)	(1-3)	9-6	(1-2)	R1					
77	77				(1-2)	(1-3)	9-6	(1-2)	R1					
78	78				(1-2)	(1-3)	9-6	(1-2)	R1					
79	79				(1-2)	(1-3)	9-6	(1-2)	R1					
80	80				(1-2)	(1-3)	9-6	(1-2)	R1					
81	81				(1-2)	(1-3)	9-6	(1-2)	R1					
82	82				(1-2)	(1-3)	9-6	(1-2)	R1					
83	83				(1-2)	(1-3)	9-6	(1-2)	R1					
84	84				(1-2)	(1-3)	9-6	(1-2)	R1					
85	85				(1-2)	(1-3)	9-6	(1-2)	R1					
86	86				(1-2)	(1-3)	9-6	(1-2)	R1					
87	87				(1-2)	(1-3)	9-6	(1-2)	R1					
88	88				(1-2)	(1-3)	9-6	(1-2)	R1					
89	89				(1-2)	(1-3)	9-6	(1-2)	R1					
90	90				(1-2)	(1-3)	9-6	(1-2)	R1					
91	91				(1-2)	(1-3)	9-6	(1-2)	R1					
92	92				(1-2)	(1-3)	9-6	(1-2)	R1					
93	93				(1-2)	(1-3)	9-6	(1-2)	R1					
94	94				(1-2)	(1-3)	9-6	(1-2)	R1					
95	95				(1-2)	(1-3)	9-6	(1-2)	R1					
96	96				(1-2)	(1-3)	9-6	(1-2)	R1					
97	97				(1-2)	(1-3)	9-6	(1-2)	R1					
98	98				(1-2)	(1-3)	9-6	(1-2)	R1					
99	99				(1-2)	(1-3)	9-6	(1-2)	R1					
100	100				(1-2)	(1-3)	9-6	(1-2)	R1					

H: C12-24P(6M) (1.365)
V: C12-24P(6M) (1.365)

1-25-1
MIS. AMBERS ESTEP

V/O GENERATED BY:
TENANT:

PLANT LEADERS	
GOVERNMENT AGENCIES	
JOINT USE PROVIDERS	
SERVICE OWNERS	X
MAINTENANCE	

STAKING SHEET

v/c 265 EXCHANGE FLATGAP

ROUTE A20 ROUTE P. 1-12

LOCATION FALLERSON CREEK

SUBSCRIBER NAME LAUSE EXT.

MELISSA MEADE

Work Order No. 98-218

Sheet No. 2 of 2

Time A20 Lead

ENGINEERING

0-2-2-10-By-21

APPENDIX

Released for Const.

COMPANY		35	R/V		PR F NO.	BACK SPAN	POLE		CUY	AMC.	GMT	Release for Const.	
JL FILE INT							L & C	TE.	"PR"	"PM"			
					P.12	102	46	25-6	VI-12	VI-54			
					P.11	344	41	30-7	VI-12	VI-13			
					P.10	374	40	25-6	VI-12	VI-54			
					P.9	272	40	25-5	VI-12	VI-54			
					P.8	264	41	30-6	VI-12	VI-54			
					P.5	264	41	30-6	VI-12	VI-54			
					P.5	288	41	35-5	VI-12	VI-54			
					P.5	78	41	30-6	VI-12	VI-54			

VI-12

VI-13

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54

VI-54


VI-54

VI-54

VI-54

VI-54

VI-54

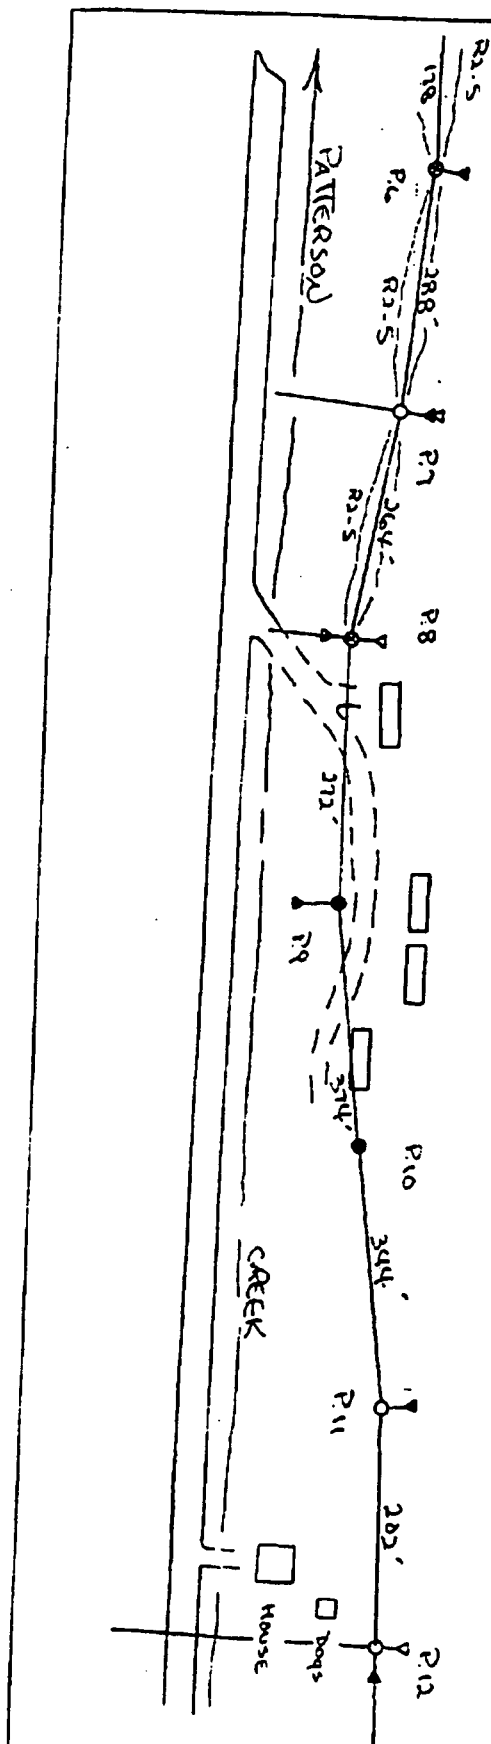

STAKING SHEET

WORK PLAN REFERENCE	
NEW CONSTRUCTION	
SYSTEM IMPROVEMENT	
REPLACEMENT	
REINFORCE AND REPLACEMENT	
MO OF SERVICES	

1964 MEMOIRS W.D. STEARNS

SYSTEM DESIGNATION: ELAT GAP
LOCATION: A 20 Route P. 3 To Pd.
TWP. _____
MAP REFERENCE: Replace GAD SPAD
SEC. _____

Work Order No. 97-297

Sheet No. 1 of 1

Line A20 _____ Limit _____

ENGINEER _____
 Stated 6-24-97 _____
 Checked _____

Released for Const.

“Yes.”

785

NOTE - E" LAST 25x24 TO
REPLACE BAD SPAN OF
CABLE APPROX. 250 FT.

SKETCH OF WORK

NOTE - "E" LASH 25x24 TO

CABLE
Approx. 250 ft.

3.

24

250

CUR. IN. Q. RT. - 06 - MAY

Turkey —
Cage

Bad ung

TRAILER

SHEID

TRAILER

Patterson


[illegible]





1000

1


Attachment C


Photographs of Accident Site

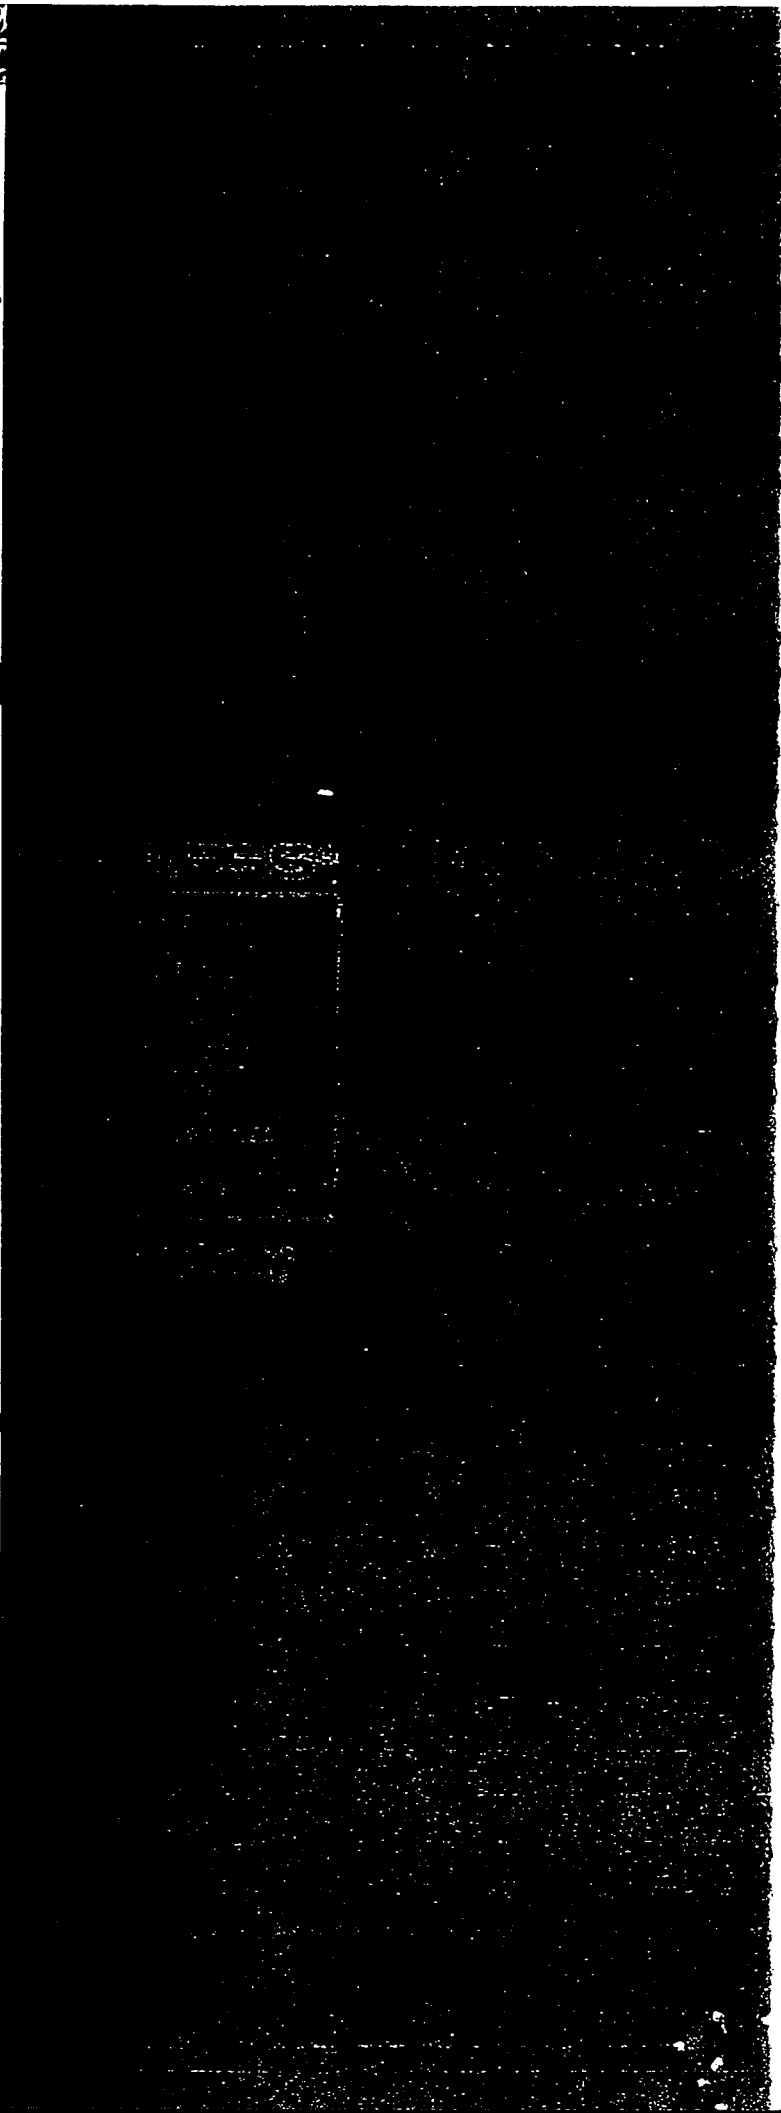

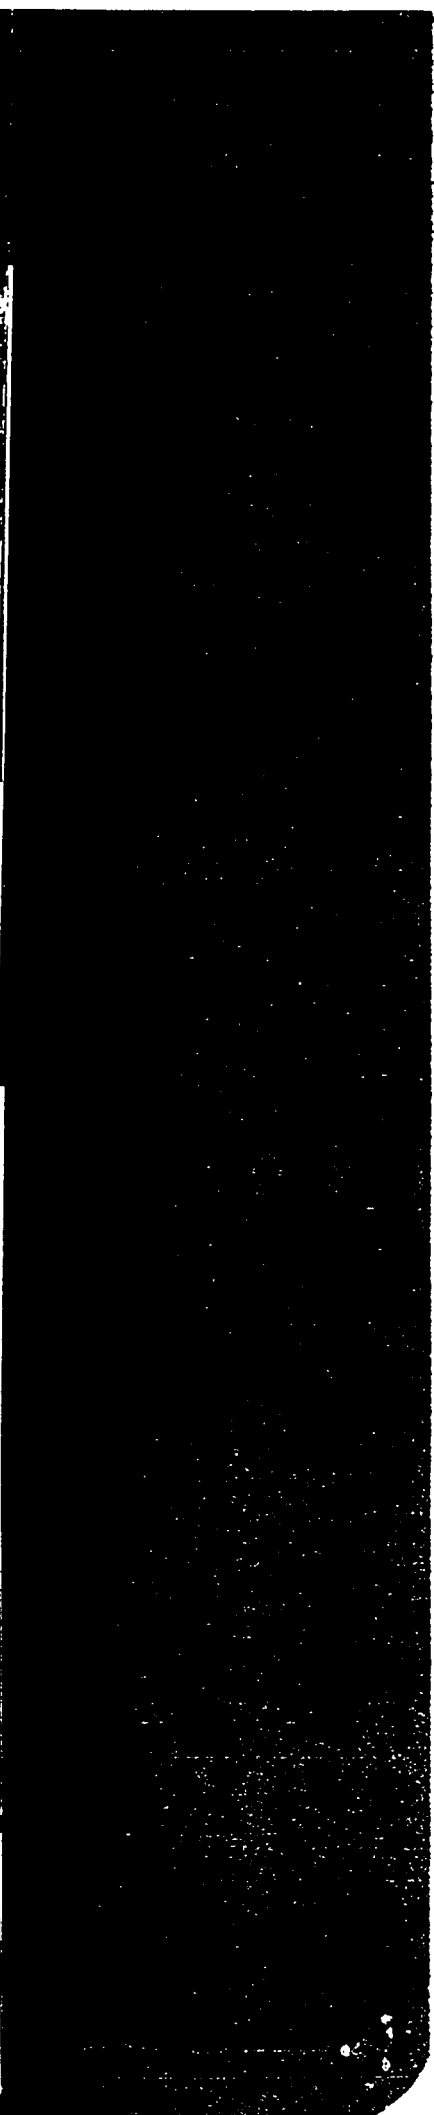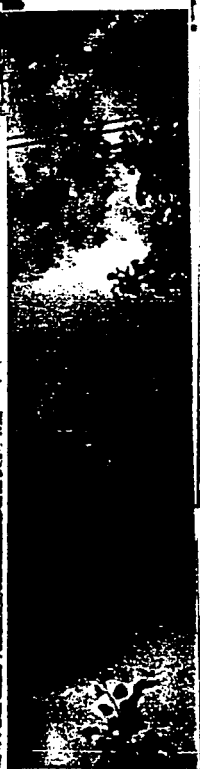
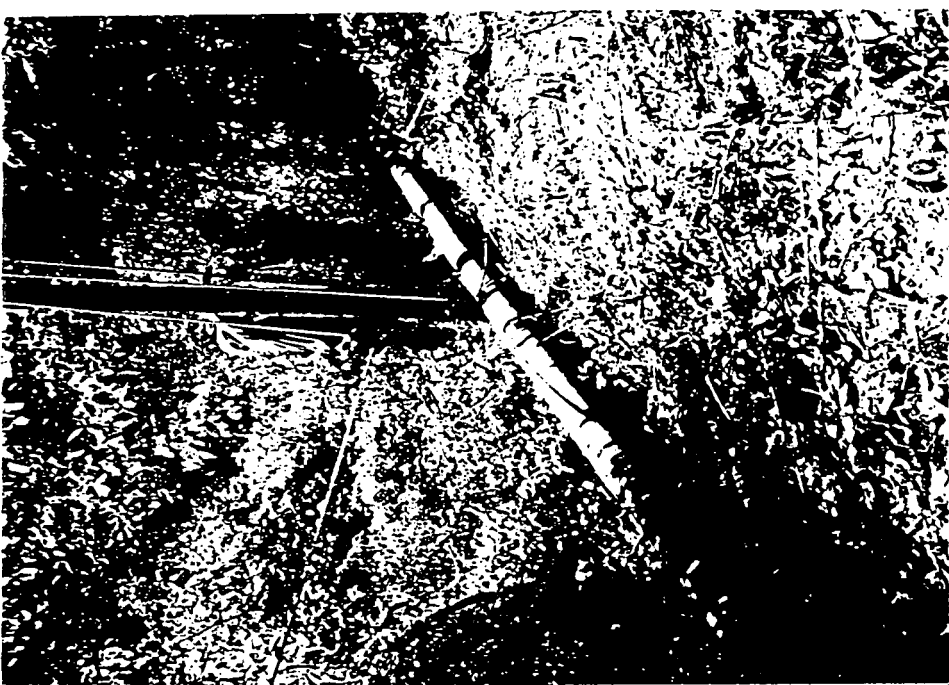
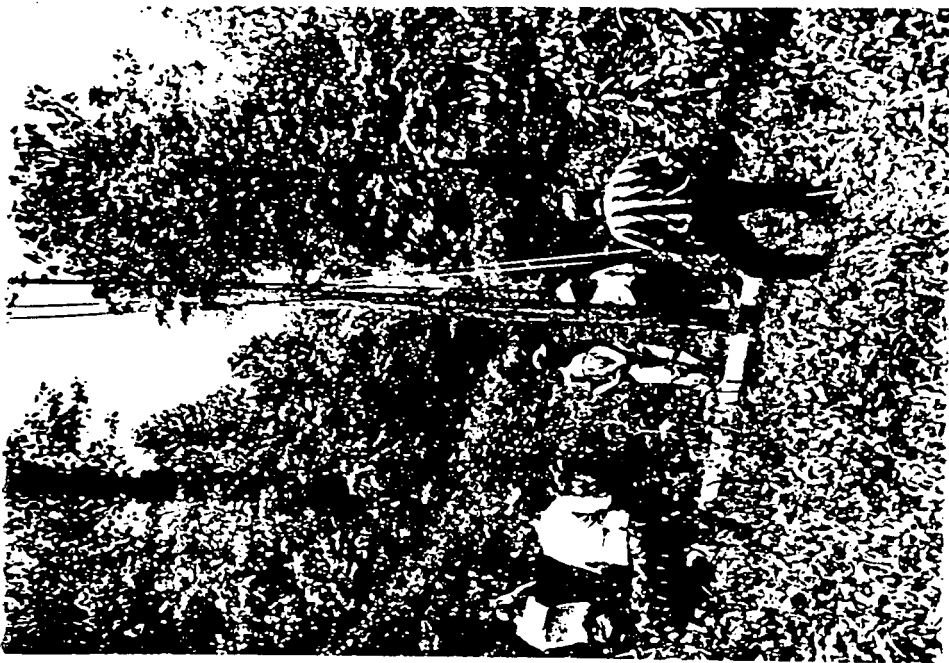




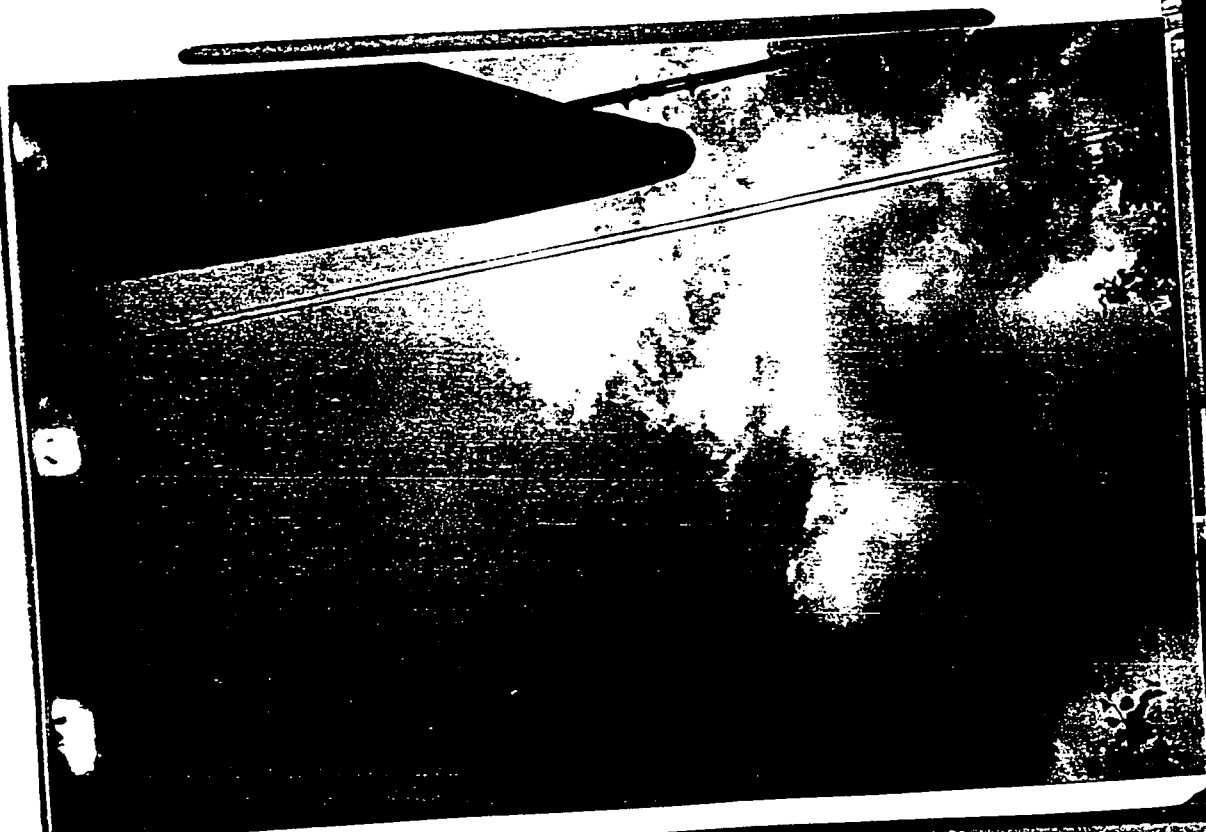

 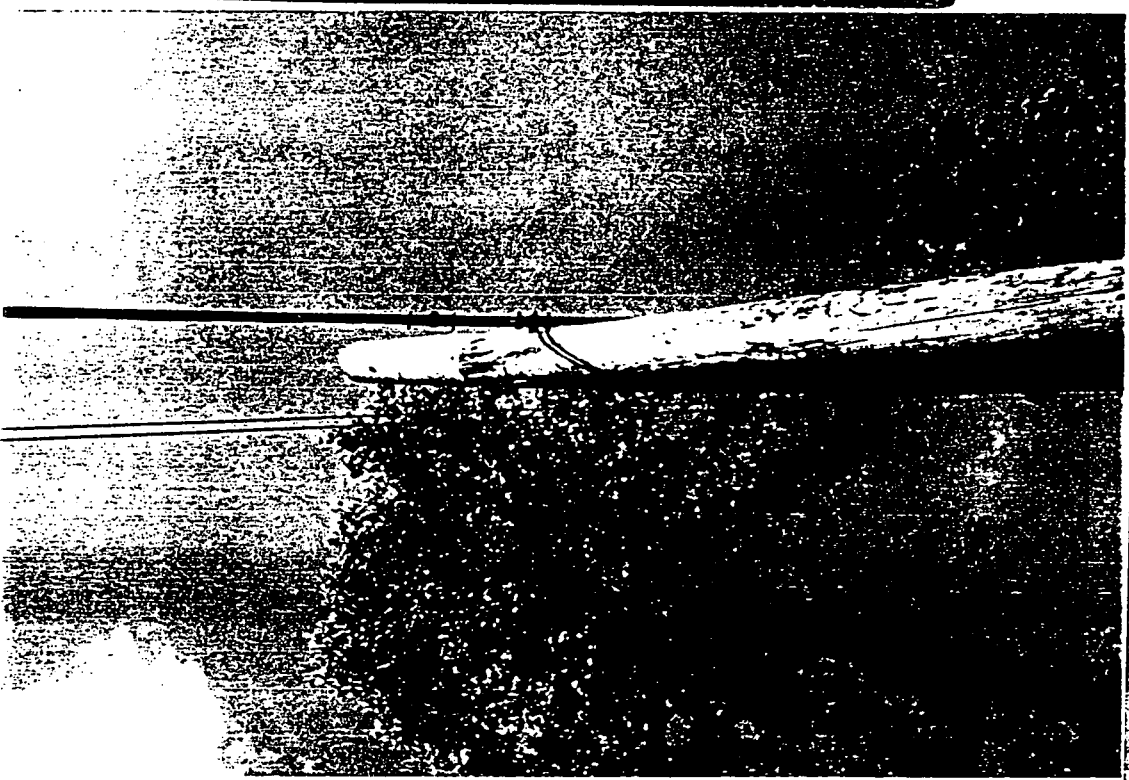



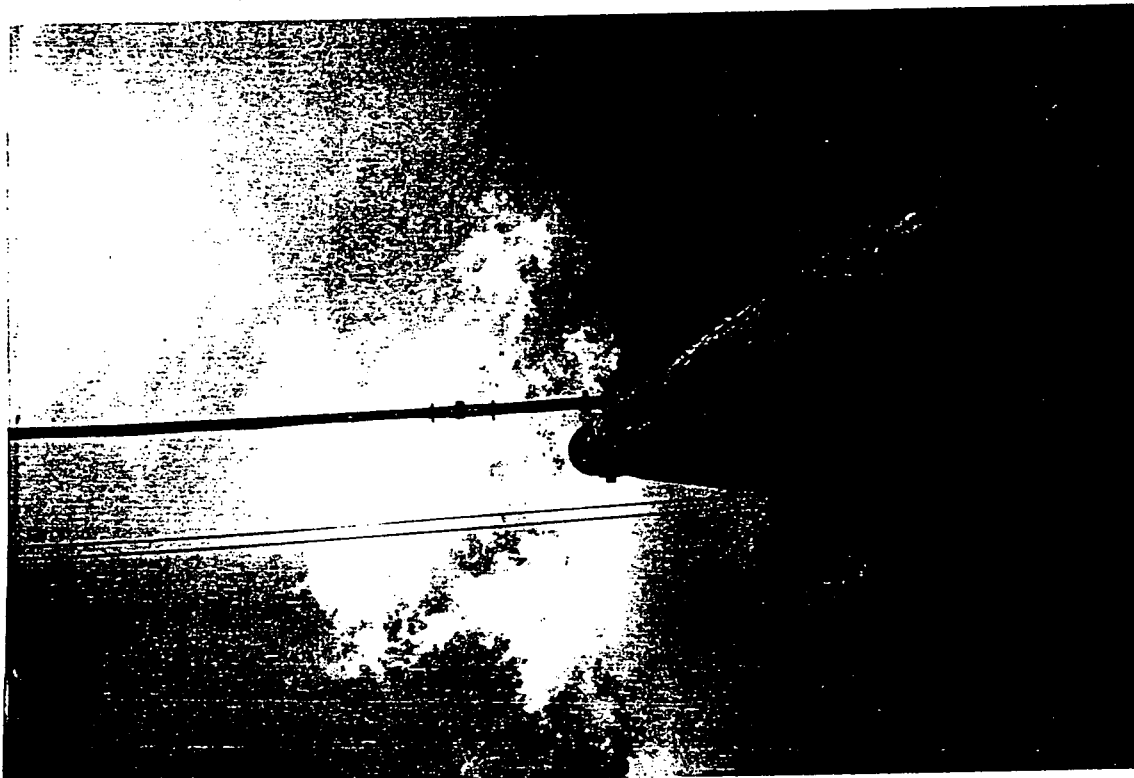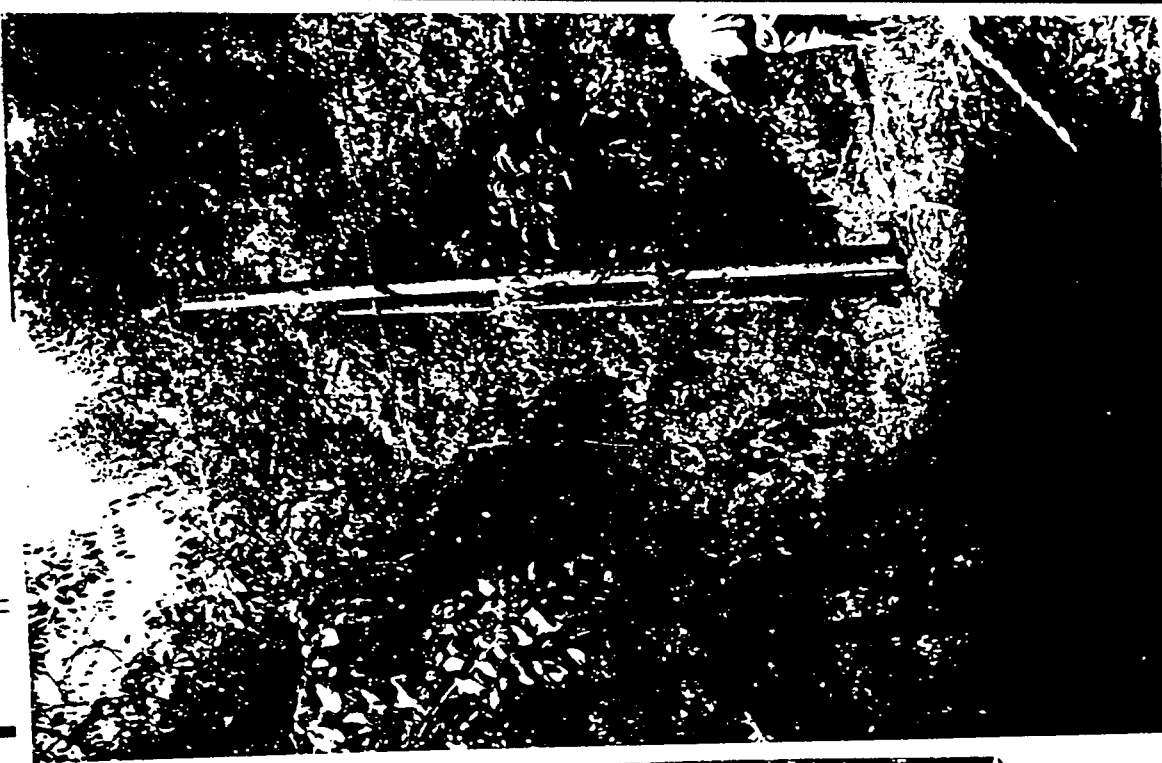



1319 Sandy Rec - Foot Hills Rural Telephone
PSC Photos

EVENT



